


Wing Nuts

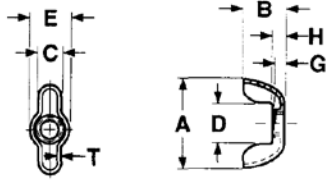

Stamped

Nominal Size or Basic Major Diameter of Thread	Threads per Inch	A		B		C		D	E		G	H	T		
		Wing Spread		Wing Height		Wing Thickness		Between Wings	Boss Diameter		Boss Height	Wall Height	Stock Thickness		
		Max.	Min.	Max.	Min.	Max.	Min.	Min.	Max.	Min.	Min.	Min.	Max.	Min.	
6	0.1380	32	0.78	0.72	0.40	0.34	0.18	0.14	0.25	0.41	0.35	0.08	0.12	0.04	0.03
8	0.1640	32	0.78	0.72	0.40	0.34	0.18	0.14	0.25	0.41	0.35	0.08	0.12	0.04	0.03
10	0.1900	24 & 32	0.91	0.85	0.47	0.41	0.21	0.17	0.34	0.53	0.47	0.10	0.12	0.04	0.03
1/4	0.2500	20	1.11	1.05	0.50	0.44	0.25	0.21	0.34	0.62	0.56	0.11	0.12	0.05	0.04
5/16	0.3125	18 & 24	1.30	1.24	0.59	0.53	0.30	0.26	0.46	0.73	0.67	0.14	0.18	0.06	0.05
3/8	0.3750	16 & 24	1.41	1.34	0.67	0.61	0.34	0.30	0.69	0.83	0.77	0.16	0.18	0.06	0.05